2.5   DRIVER REPLACEMENT METHOD

If a former USB driver for DC-7104 or DC7204 is used in your computer, the USB driver must be updated to output correct data.
Update the driver according to the following procedure.

> ⚠ **Cautio**   It may seem that a former USB driver operates correctly.   However, correct data cannot be output unless the USB driver is updated.   Be sure to replace with the latest USB driver.
> In case of using multiple ports in one computer, update the USB driver for all of the ports.
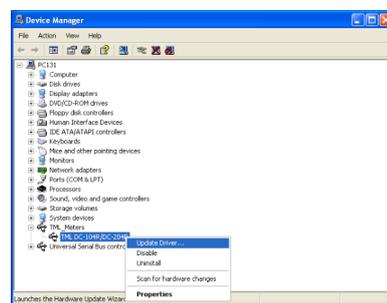
[Operation Method]

1. Connect the DC-104R/104Ra and the personal computer with USB cable, with the power of DC-104R/104Ra supplied.

2. Open [Control Panel]-[System]-[Hardware]-[Device Manager].
   If [DC-104R] under [Human Interface Device] is displayed, proceed to the step 6.
   If [TML DC-104R] under [TML_Meters] is displayed, proceed to the step 3.

3. Right-click on [TML DC-104R] under [TML_Meters] and click on [Driver Upgrade].

4. For the subsequent procedures, see HOW TO INSTALL DRIVER to upgrade the driver.
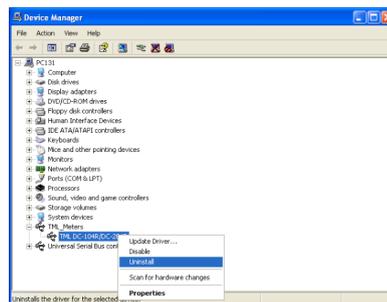
5. Proceed to the step 11.

6. Delete [DC-104R] under [Human Interface Device].   If multiple [DC-104R] are displayed, delete all of them.

7. Open [Start]-[All Programs]
   -[Accessory]-[Command Prompt].

8. Move to the [Driver] folder in the folder in which the application (DC-7104) is installed.
   Ex) cd C:¥Program Files¥DC-7104¥driver

9. Enter the following command.
   wdreg_gui remove

10. Press the Close button or enter "exit" to close the command prompt.

11. Open [Start]-[Control Panel]-[Add or Remove Applications].
    Select [DC-7104] to remove it.

12. Referring to "2.2 Installation of DC-7104", install DC-7104.

13. For the subsequent procedures, see HOW TO INSTALL DRIVER to install the driver.